

# <u>User Inspection Notice</u>

MSA V-EDGE® Web PFLs

August 2025
PLEASE READ NOW AND TAKE ACTION

#### MSA Corporate Center 1000 Cranberry Woods Drive Cranberry Township, PA 16066 800.MSA.2222 www.MSAsafety.com

#### **Dear MSA Fall Protection Customer,**

MSA is issuing this Inspection Notice to alert you to the need for an additional step in your pre-use checks and examination procedures regarding your MSA V-EDGE Web PFLs (Personal Fall Limiters) that were manufactured between May 2018 up to and including January 2025. See appendix for individual model numbers.

MSA has received an isolated field report that a bolt that connects the PFL ring to the Energy Absorber of the V-EDGE Web PFL separated from the unit, resulting in the unit being non-functional. MSA has not received any reports of injuries associated with this condition. However, we request that you perform the inspection outlined in this notice prior to your next use and include it in your pre-use checks and examination procedures.



Figure 1: V-EDGE Web Personal Fall Limiter (PFL)

MSA is advising all customers to inspect for the presence of the silver roll pin during pre-use checks for MSA V-EDGE Web PFLs listed in this notice.

Inspect all units per the instructions in this notice prior to your next use. If any PFL does not pass this inspection, remove it from service and contact MSA.



# **Inspection Procedure**

Perform the following inspection on your entire stock prior to next use to determine if any of your PFLs need to be taken out of service. This check should also be incorporated into your pre-use check and examination procedures moving forward.

#### **MSA Corporate Center**

1000 Cranberry Woods Drive Cranberry Township, PA 16066 800.MSA.2222 www.MSAsafety.com

# 1) Confirm Model Number and Manufacturing Date – Refer to Figure 2

#### a. Model Number

- i. Confirm that your model number is listed in the table in the appendix.
- ii. If your model number is not listed, no further action is needed.

# b. Manufacturing Date

- i. Confirm that your manufacturing date is between 05/2018 and 01/2025
- ii. If the date is outside of this range, no further action is needed.



Figure 2: Product Identification



- Inspect the product Visually inspect the bolt that connects the PFL ring to the Energy Absorber of the V-EDGE PFL for the presence of the silver roll pin. (Figure 3)
  - a. Roll pin is present and flush Continue using product per manufacturer recommendations.
  - b. Roll pin is protruding or not present Remove the product from service and follow the procedure below for a replacement unit.







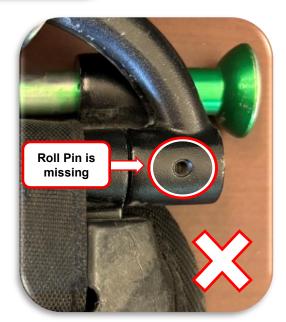


Figure 3: Roll Pin Inspection

Please remember to review the full user manual, 10191702, for all required inspection steps and frequencies.

# MSA The Safety Company

# Replacing Affected MSA V-EDGE Web PFLs

If you are in possession of any MSA V-EDGE Web PFLs whose roll pin is not properly secured, we will replace them free of charge. In an effort to minimize any disruption, we pledge to take any replacement actions as expeditiously as possible.

MSA Corporate Center 1000 Cranberry Woods Drive Cranberry Township, PA 16066 800.MSA.2222 www.MSAsafety.com

Please note that the MSA V-EDGE Web PFLs included in this notice were discontinued in January 2025 when the V-TEC EDGE Web PFL was launched. Any replacements needed will be provided using a current and equivalent MSA V-TEC EDGE Web PFL.

To receive a replacement, please contact MSA as shown below. Replacement PFLs will be shipped to you, and we will forward you instructions for returning the same quantity of affected PFLs.

## **MSA Customer Service Contact Information**

If you have any questions regarding this Inspection Notice, please contact us as shown below:

US and Canada: call 866-672-0005 or Email us at ProductSafetyNotices@msasafety.com

**Europe**, **Middle East**, **and Africa**: Email us at <a href="mailto:ProductUserNotice@msasafety.com">ProductUserNotice@msasafety.com</a> or contact your local MSA customer service representative

All other regions: Contact your local MSA customer service representative.

Thank you for your continued trust in our products

Best regards,

Adam Troup

**Product Safety Manager** 



# Appendix: Potentially Affected Model Numbers

Material	Description
10192006	PFL, V-EDGE, WEB, 8FT, AL36CL, ANSI
10192007	PFL, V-EDGE, WEB, 8FT, AL36CL, CSA
10192008	PFL, V-EDGE, WEB, 2.4M, AL36CL, EN
10192009	PFL, V-EDGE, WEB, 8FT, TWIN, AL36CL,ANSI
10192010	PFL, V-EDGE, WEB, 8FT, TWIN, AL36CL, CSA
10192011	PFL,V-EDGE,WEB, 2.4M, TWIN,REBAR ALSWLEN
10192012	PFL, V-EDGE, WEB, 8FT, 36C, ANSI
10192013	PFL, V-EDGE, WEB, 8FT, 36C, CSA
10192015	PFL, V-EDGE,CINTA,2.4 DOBLE, 36C, ANSI
10192022	PFL, V-EDGE, WEB, 8FT, AL SWV CARAB,ANSI
10192024	PFL, V-EDGE, WEB, 2.4M, AL SWV CARAB, EN
10192025	PFL,V-EDGE,WEB,8FT,TWIN,AL SWV CARA,ANSI
10192027	PFL,V-EDGE,WEB,2.4M,TWIN,AL SWV CARAB,EN
10192032	PFL, V-EDGE, WEB, 8FT, AL CARAB, ANSI
10192039	PFL, V-EDGE, WEB, 8FT, SM SWV HOOK, ANSI
10192040	PFL, V-EDGE, WEB, 8FT, SM SWV HOOK, CSA
10192041	PFL, V-EDGE, WEB, 2.4M, SM SWV HOOK, EN
10192042	PFL,V-EDGE,WEB,8FT,TWIN,SM SWV HOOK,ANSI
10192043	PFL,V-EDGE,WEB,8FT,TWIN,SM SWV HOOK,CSA
10192044	PFL,V-EDGE,WEB,2.4M,TWIN,SM SWV HOOK,EN
10192048	PFL, V-EDGE, WEB, 8FT, 36CL, ANSI
10192049	PFL, V-EDGE, WEB, 8FT, 36CL, CSA
10192050	PFL, V-EDGE, WEB, 2.4M, REBAR,SWL, EN
10192051	PFL, V-EDGE, WEB, 8FT, TWIN, 36CL, ANSI
10192052	PFL, V-EDGE, WEB, 8FT, TWIN, 36CL, CSA
10192053	PFL, V-EDGE,WEB, 2.4M, TWIN,REBAR SWL,EN
10192516	PFL, V-EDGE, WEB, 9FT, TWIN, FP5K, ANSI
10192519	PFL, V-EDGE, WEB, 9FT, FP5K, ANSI
10227165	PFL,V-EDGE,WEB,8FT,TWIN,COATED HOOK,ANSI

## MSA Corporate Center 1000 Cranberry Woods Drive Cranberry Township, PA 16066 800.MSA.2222 www.MSAsafety.com